

SERVICE *No. 840* BULLETIN

* **PIPER CONSIDERS** *
* **COMPLIANCE MANDATORY** *

FAA Approved

Date June 19, 1986

S

This Service Bulletin is divided into Two (2) Parts. Part I supersedes Service Letter No. 588, dated September 3, 1971. Part II supersedes Service Letter No. 590, dated May 25, 1972. Refer to each Part for Serial Numbers affected.

SUBJECT:

Fuel Selector Valve Cover
Replacement

MODELS AFFECTED:

PA-28-140 Cherokee
PA-28-150/160/180 Cherokee
PA-28R-180 Cherokee Arrow
PA-28R-200 Cherokee Arrow

SERIAL NUMBERS AFFECTED:

28-20000 through 28-26946, and
28-7125001 through 28-7125666
28-01 through 28-5859, and
28-7105001 through 28-7105259
28R-30000 through 28R-31270, and
28R-7130001 through 28R-7130038
28R-35001 through 28R-35820, and
28R-7135001 through 28R-7135254

COMPLIANCE TIME:

At the next regularly scheduled inspection event,
but not to exceed twenty-five (25) hours of operation.

PURPOSE:

To announce the availability of a new fuel
selector valve cover assembly and mating handle, which reduces the possibility of
pilot mismanagement of the fuel system through inadvertent selection to the "OFF"
position, resulting in power interruption or stoppage.

PART I

MODELS AFFECTED:

PA-28-140 Cherokee
PA-28-180 Cherokee
PA-28R-180 Cherokee Arrow
PA-28R-200 Cherokee Arrow

SERIAL NUMBERS AFFECTED:

28-7125001 through 28-7125666
28-7105001 through 28-7105259
28R-7130001 through 28R-7130038
28R-7135001 through 28R-7135254

INSTRUCTIONS:

All instructions necessary to accomplish this
modification are contained in Piper Kit No. 760-545V, Fuel Selector Valve Cover
Replacement.

(over)
ATA: 2822

NOTE: If Service Letter No. 588 has been complied with, the affected aircraft is in compliance with Service Bulletin No. 840 and no further action is necessary.

MATERIAL REQUIRED: One (1) each Fuel Selector Valve Cover Replacement Kit, Piper Part Number 760-545V, per aircraft, and one (1) each Air Vent Flange Kit, Piper Part Number 65735-219, color black, per aircraft.

PART II

MODELS AFFECTED:

PA-28-140 Cherokee
PA-28-150/160/180 Cherokee
PA-28R-180 Cherokee Arrow
PA-28R-200 Cherokee Arrow

SERIAL NUMBERS AFFECTED:

28-20000 through 28-26946
28-01 through 28-5859
28R-30000 through 28R-31270
28R-35001 through 28R-35820

INSTRUCTIONS: All instructions necessary to accomplish this modification are contained in Piper Kit No. 760-546V, Fuel Selector Valve Cover Replacement.

NOTE: If Service Letter No. 590 has been complied with, the affected aircraft is in compliance with Service Bulletin No. 840 and no further action is necessary.

MATERIAL REQUIRED: One (1) each Fuel Selector Valve Cover Replacement Kit, Piper Part Number 760-546V, per aircraft.

AVAILABILITY OF PARTS: Your Piper Field Service Facility.

EFFECTIVITY DATE: This Service Release is effective upon receipt.

SUMMARY: Please contact your Piper Field Service Facility to make arrangements for compliance with the provisions of this Service Bulletin within the compliance time indicated.

The material required for this modification will be provided at a Special Price, through your Piper Field Service Facility, for a period of time not to exceed 180 days from the date of this Service Bulletin, when compliance is accomplished at an authorized Piper Field Service Facility.

NOTE: If you are no longer in possession of this aircraft, please forward this information to the present owner.